



FIELD CHANGE ORDER

Service

Issued by : PMS DMC Hamburg

Released by : R. Villbrandt **signed**

Publication No. : 4512 980 59561

Reference No. : FCO74200005

Date : August 2002

Product Group : 742



OPTIMUS C

APPLIES TO:

All Optimus C generators specified by PEI and serial number

Physical Block	PEI	serial number(s)
PB010048	9890 000 02021	996001 - 996106; SN006001 - SN006084; SN016001 - SN016246 SN026001 - SN026104

TITLE:

Cockpit fan modification

LIST OF PAGES & DRAWINGS:

FCO74200005	1 ... 2	02.0
	ANR	02.0

INTRODUCTION:

Symptom : Various Cockpit failures such as hang-up, no booting, interrupted booting process etc. with error causes that cannot directly be identified

Cause : Overheating of the CPU in the Cockpit caused by insufficient heat dissipation

Remedy : Modification of the Cockpit with a high-capacity fan

MANPOWER / TIME TO COMPLETE:

1 hour, 1 service engineer

TOOLS & TEST EQUIPMENT:

Standard tool set
3 mm Allen key
5.5 mm socket spanner

MODIFICATION KIT / PARTS REQUIRED:

4512 104 96601

Containing:

12NC	Name
	Cockpit Fan modification kit
4512 980 xxxxx	FCO74200005
4512 984 26331	Modification instructions

Ordering information: The SSDs are notified of the quantity by Service Logistics, Hamburg.
Kits are delivered free of charge until September 1st, 2003.

PROCEDURE:

1. Switch the Cockpit (the generator) OFF.
2. Open the Cockpit.
3. Remove the CPU fan, if applicable.
4. Install the new fan kit.
5. Close all covers.
6. Switch the Cockpit (the generator) ON.
7. Test all applicable functions.

Detailed modification instructions are delivered with the kit.

PARTS DISPOSAL:

All parts are to be disposed of in a safe way in accordance with local safety regulations.

DOCUMENTATION:

- Log this action in the section "History Record" of the System Reference Manual.
- File this FCO in the section "Service Information" of the System Reference Manual.
- Fill out the attached Action Notification Report and send it to your SSD Customer Support Manager.

FCO ACTION NOTIFICATION REPORT

For local SSD use only; do not return to PMG.

TITLE : Cockpit Fan modification

CLASSIFICATION : *Proactive - Action for Performance*

FCO REF. NO.: **FC074200005**

APPLIES TO : *All Optimus C generators*

HOSPITAL / ADDRESS :

LOCATION / FW SITE NO.:

SALES ORDER NO. / OA NO.:

PRODUCT NUMBER :

[illegible]

UNIT SERIAL NUMBER :

--

ACTION ON THIS UNIT WAS: (select one)

JOB NO. / SERVICE INCIDENT NO.:

Completed per instruction on

DATE _____

Completed by the factory prior to delivery.

Not completed as this unit is not affected per instruction because: (state reason)

1

Not completed because customer has unit in storage.
Required parts & instructions received by the customer.

CUSTOMER ACKNOWLEDGEMENT (Required for **MANDATORY ACTIONS** only).

The **REASON** and **PURPOSE** of this modification have been explained to me.

CUSTOMER NAME (PLEASE PRINT)

TITLE

CUSTOMER SIGNATURE

DATE _____

BRANCH
REGION /
DEALER :

SERVICE UNIT /
SERVICE AREA NO.:

SIGNATURE CUSTOMER SUPPORT ENGINEER

DATE _____

SIGNATURE CUSTOMER SUPPORT MANAGER

MAIL TO : SSD Customer Support Manager